

42U Adjustable 4 Post Open Frame Server Rack



Actual product may vary from photos

User Manual SKU#: 4POSTRACK42

> For the latest information and specifications visit www.startech.com/4POSTRACK42

Use of Trademarks, Registered Trademarks, and other Protected Names and Symbols

This manual may make reference to trademarks, registered trademarks, and other protected names and/or symbols of third-party companies not related in any way to StarTech.com. Where they occur these references are for illustrative purposes only and do not represent an endorsement of a product or service by StarTech.com, or an endorsement of the product(s) to which this manual applies by the third-party company in question. Regardless of any direct acknowledgement elsewhere in the body of this document, StarTech.com hereby acknowledges that all trademarks, registered trademarks, service marks, and other protected names and/or symbols contained in this manual and related documents are the property of their respective holders.

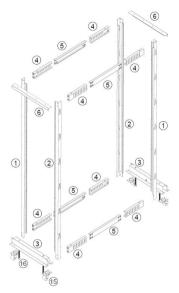


Table of Contents

.3
.4
.9
.13
.14
.15
.16
.17
.18




Product Diagram




1	Left Vertical Rails (x 2)	5	Center Beams (x 4)
2	Right Vertical Rails (x 2)	6	Top Brackets (x 2)
3	Base Brackets (x 2)	15	Leveler Feet (x 4)
4	Corner Beams (x 8)	16	Casters (x 4)



Package Contents

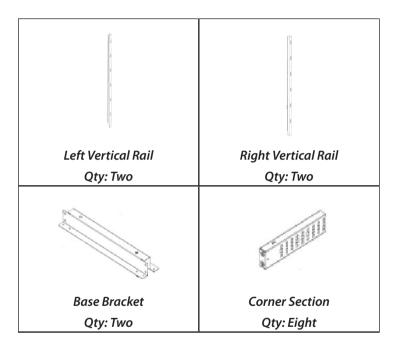




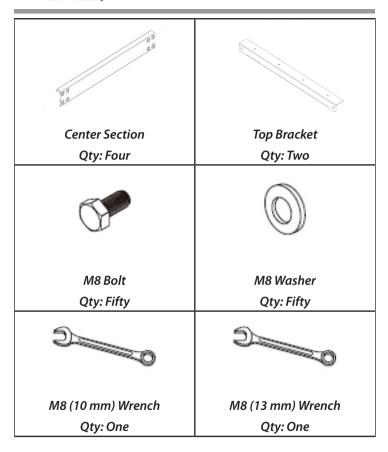




Phillips Head Screwdriver	M6 Cage Nuts
Qty: One	Qty: Fifty
\bigcirc	(x)
PVC Cup Washer	M6 Phillips Head Screw
Qty: Fifty	Qty: Fifty
	A Providence
Cable Management Hooks	Hook Mounting Screws
Qty: Twenty Four	Qty: Twenty Four



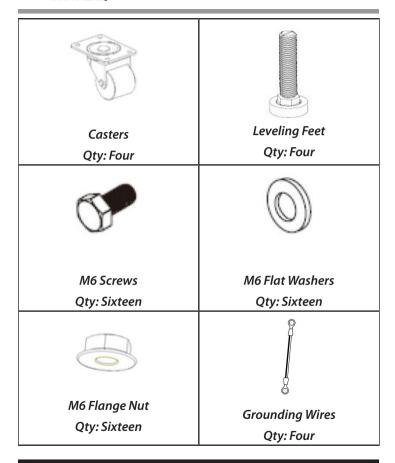



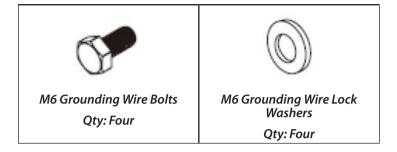

Installation

1. Align the **Corner Beams** (x 2) with the **Center Beam**, Sliding the **Corner Beams** overtop of the **Center Beam**. The two **Corner Beams** should be on top of the **Center Beam**.



Align the Corner Beams (x 2) with the Center Beam

- 2. Slide the **Corner Beams** (x 2), inward along the **Center Beam**, to adjust the mounting depth of the **Rack**.
- 3. To Adjust the mounting depth align the numbers on the **Center Beam** with the first **Rectangular Cutout** on the **Corner Beams** (x 2). For more mounting depth options see the <u>Mounting Depth Chart</u>.



Aligning the Rectangular Cutout

Note If you what to achieve a mounting depth of 34" both of the first **Rectangular Cutouts** must be aligned with the number 6.

 When you have the mounting depth set, insert the M8 Bolt (x 8) through the Corner Beams (four per beam), and into the Center Beam.





Inserting the M8 Bolt at position 8 and 9


- 5. On the back on the **Center Beam** align the **M8 Washers** (x 8) with the **M8 Bolts** inserted in step 4.
- Use the Wrenches (included) to hold the M8 Washer while tightening the M8 Bolt. Tighten all M8 Bolts, being careful not to over-tighten.
- Align the Left Vertical Rail with the Screw Holes at the end of the Beam Assembly (which consists of two Corner Beams and one Center Beam).

Note: The side with the two **Screw Holes** at the end of the **Left Vertical Rail** is the bottom of the **Rack**.

- Align the Screw Holes on the Top Bracket with the Screw Holes on the Left Vertical Rail. Align M8 Washers (x 2) with the Screw Holes on the end and top of the Top Bracket. Make sure that the Top Bracket is on the outside or overtop of the Left Vertical Rail.
- 9. Insert an **M8 Bolt** through the end **Screw Hole** on the **Top Bracket** and into the **Left Vertical Rail**.
- 10. Insert an **M8 Bolt** through the top **Screw Hole** on the **Left Vertical Rail** and into the **Beam Assembly**.
- 11. Using the included **Wrench** tighten the **M8 Bolts** being careful not to over-tighten.

To view manuals, videos, drivers, downloads, technical drawings, and more visit www.startech.com/support




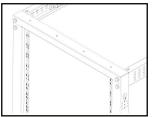

Aligning the Top Bracket with the Vertical Rail


- 12. Align the Screw Holes in the Base Bracket with the Screw Holes in the Left Vertical Rail.
- 13. Align the **M8 Washers** (x 2) with the **Screw Holes** on the end and top of the **Base Bracket**.
- 14. Insert two **M8 Bolts** through the end **Screw Holes** and into the **Left Vertical Rail**.
- 15. Using the **Wrench** (included), tighten the **M8 Bolts**, being careful not to over-tighten.
- 16. Align the Screw Holes on the Base Bracket with the Screw Holes on the Left Vertical Rail.



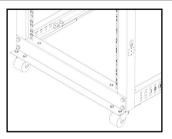

Aligning the Base Bracket with the Vertical Rail

- 17. Repeat steps 7 17 to install the **Right Vertical Bracket**, **Top**, and **Base Brackets**.
- 18. When you have one side assembled repeat steps 7 17 to assemble the other side of the **Rack**.

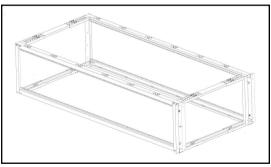

Assembled Rack




Installing the Casters

1. Make sure that the **Rack** is positioned on it side.

Note: Two people are required for repositioning the Rack.

- 2. Algin the **Mounting Holes** on the **Casters** with the **Caster Mounting Holes** on the bottom of the **Rack**.
- 3. Insert the **M6 Screws** (x 4) through the **Flat Washers** (x 4).
- Insert the M6 Screws and Flat Washers through the Rack and Caster and into the M6 Flange Nut.

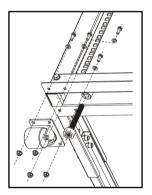

Installing the Casters

5. Use the **Phillips Head Screwdriver** (included) to tighten the **M6 Screws**.




Installing the Levelers

1. Make sure that the **Rack** is positioned on it side.

Note: Two people are required for repositioning the Rack.

2. Algin the **Levelers** (x 4) with the **Leveler Mounting Holes** on the bottom of the **Rack**.

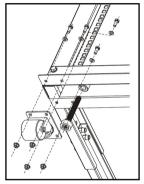


Installing the Levelers

 Insert the Levelers into the Leveler Mounting Holes. Tighten the all four Levelers to the same height so that the Rack is level.



Installing the Cable Management Hooks

- 1. Align the **Cable Management Hooks** with the **Cable Management Screw Holes** along the back of the **Rack**.
- 2. Insert a **Hook Management Screw** though the **Rack** and into the **Cable Management Hook**.
- 3. Using the **Phillips Head Screwdriver**, tighten the **Hook Management Screw** being careful not to over-tighten.

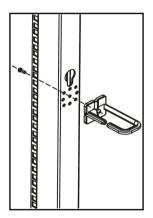


Installing the Cable Management Hooks



Grounding the Rack

 Insert an M6 Screw through the Grounding Point on the Grounding Wire and into the Ground Hole located on the bottom of the Rack.

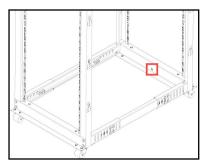

Grounding the Rack

- 2. Run the Grounding Wire under the Rack's Frame.
- 3. Connect the **Grounding Wire** to an earth ground connection.



Mounting Depth Chart

Mounting Depth	Numbers	Mounting Depth	Numbers
22 in.	0 and 0	32 in.	5 and 5
23 in.	1 and 0	33 in.	5 and 6
24 in.	1 and 1	34 in.	6 and 6
25 in.	1 and 2	35 in.	6 and 7
26 in.	2 and 2	36 in.	7 and 7
27 in.	2 and 3	37 in.	7 and 8
28 in.	3 and 3	38 in.	8 and 8
29 in.	3 and 4	39 in.	8 and 9
30 in.	4 and 4	40 in.	9 and 9
31 in.	4 and 5		



Specifications

U Height	42U
Material	Steel
Rack Type	4-Post
Frame Type	Open Frame
Colour	Black
Minimum Mounting Depth	22 in. (558.8 mm)
Maximum Mounting Depth	40 in. (1016 mm)
Dimensions (WxHxD)	23.6x80.5x26 in. (600x2045x662 mm)
Weight	84.9 lb. (38.5 kg)



Warranty Information

This product is backed by a two-year warranty.

For further information on product warranty terms and conditions, please refer to <u>www.startech.com/warranty</u>.

Limitation of Liability

In no event shall the liability of StarTech.com Ltd. and StarTech.com USA LLP (or their officers, directors, employees or agents) for any damages (whether direct or indirect, special, punitive, incidental, consequential, or otherwise), loss of profits, loss of business, or any pecuniary loss, arising out of or related to the use of the product exceed the actual price paid for the product.

Some states do not allow the exclusion or limitation of incidental or consequential damages. If such laws apply, the limitations or exclusions contained in this statement may not apply to you.



Hard-to-find made easy. At StarTech.com, that isn't a slogan. It's a promise.

StarTech.com is your one-stop source for every connectivity part you need. From the latest technology to legacy products — and all the parts that bridge the old and new — we can help you find the parts that connect your solutions.

We make it easy to locate the parts, and we quickly deliver them wherever they need to go. Just talk to one of our tech advisors or visit our website. You'll be connected to the products you need in no time.

Visit www.startech.com for complete information on all StarTech.com products and to access exclusive resources and time-saving tools.

StarTech.com is an ISO 9001 Registered manufacturer of connectivity and technology parts. StarTech.com was founded in 1985 and has operations in the United States, Canada, the United Kingdom and Taiwan servicing a worldwide market.

Reviews

Share your experiences using StarTech.com products, including product applications and setup, what you love about the products, and areas for improvement.

StarTech.com Ltd.	StarTech.com LLP	StarTech.com Ltd.
45 Artisans Cres.	2500 Creekside Pkwy.	Unit B, Pinnacle
London, Ontario	Lockbourne, Ohio	15 Gowerton Rd., Brackmills
N5V 5E9	43137	
Canada	U.S.A.	Northampton
		NN4 7BW
		United Kingdom
FR: startech.com/fr	ES: startech.com/es	IT: <u>startech.com/it</u>
DE: startech.com/de	NL: startech.com/nl	JP: <u>startech.com/jp</u>